


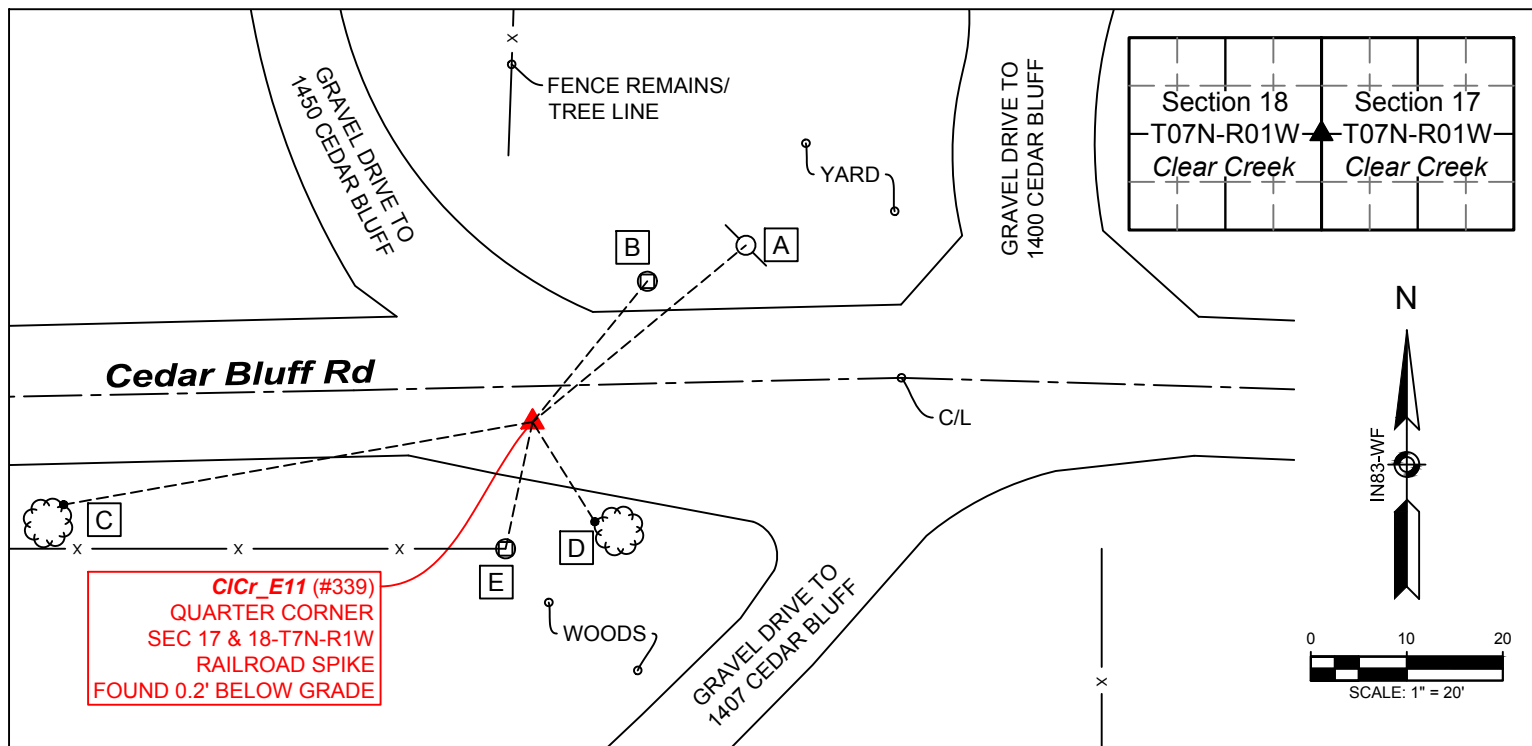

NOTES:


- Field work was performed on May 22, 2017.
- Monroe County Surveyor's Field Book 50, page 40.
- Project Name: ClearCreek2017, Field work by: RSO, Drawn by: RSO, Reviewed by: RSO & TER.
- Coordinates shown hereon were obtained from GPS observations utilizing the Indiana Real-Time Network (INCORS). Indiana West Zone, NAD83(2011) Epoch 2010.0000, State Plane Grid Coordinates, US Survey Feet. Geoid model G2012BU7. Datum NAD83_NO_TRANS.
- Coordinate data for C1Cr_E11 was collected using a Topcon Network Rover (PG-A1 antenna and GRS-1 data collector).
- Vicinity sketch was compiled per 2017 aerial photography. Distances to witness ties were collected with a 100' cloth tape. Bearings to witness monument ties were measured with a 2° compass adjusted for declination and are approximately shown hereon for reference. Priority should be given to provided distances over bearings.
- This monument was accepted by the Monroe County Surveyor Michael Friley on January 4th, 1995. We collected coordinates on the known monument in preparation for an upcoming perpetuation survey in the area. Historic research has not yet been performed to prove the validity of this monument. The prior Monument Record references a Lee Utt survey dated 4/28/89, recorded on 6/29/1989 in Survey Book 1, page 109.

WITNESS MONUMENT TIES:

- PK nail found 0.4' above grade in the southeast side of 9" PSI utility pole #177-340; N 50° E 28.8'
- MAG nail and 2" shiner set 0.2' above grade in the south side of mailbox post #1450; N 40° E 19.2'
- MAG nail set in hack 3.7' above grade in the northeast side of a 26" tulip poplar; S 80° W 49.6'
- MAG nail set in hack 1.1' above grade in the west side of a 14" tulip poplar; S 32° E 12.25'
- T-post in east/west fence with Monroe County Surveyor Marker sign attached to the north side, 3.7' above grade; S 12° W 13.5'

OTHER OBSERVATIONS:

There is an apparent tree line with north/south fence remains in line with the railroad spike on the north side of Cedar Bluff Road. The railroad spike is 3.7' south of the centerline of Cedar Bluff Road.

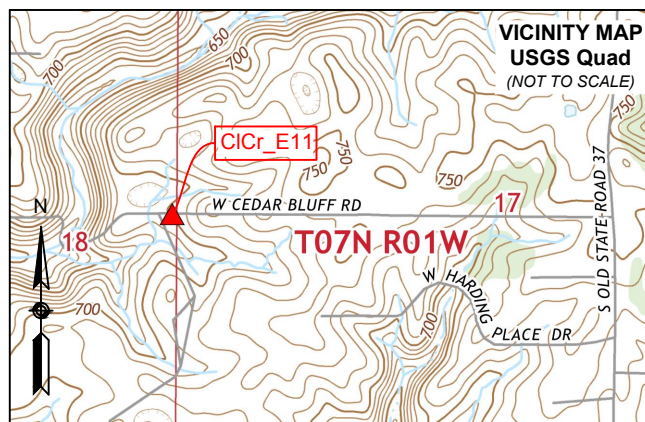

▲ **Monument Description:** Railroad spike found 0.2' below grade, 3.7' south of centerline of Cedar Bluff Road

State Plane Grid Coordinates: Northing: 1382270.6', Easting: 3103102.0'

SHEET
1
OF
2


MONUMENT RECORD
CORNER ID:
C1Cr_E11

Quarter Corner
Section 17 & 18- T07N-R01W
Clear Creek Township
Monroe County, Indiana



OFFICE OF THE MONROE COUNTY SURVEYOR
Trohn Enright-Randolph Monroe County Surveyor
Rachel Savich Oser Professional Surveyor
119 West 7th Street, Bloomington, IN 47404 (812) 349-2570

Photos were taken on 5/22/2017 with an iPhone 6s

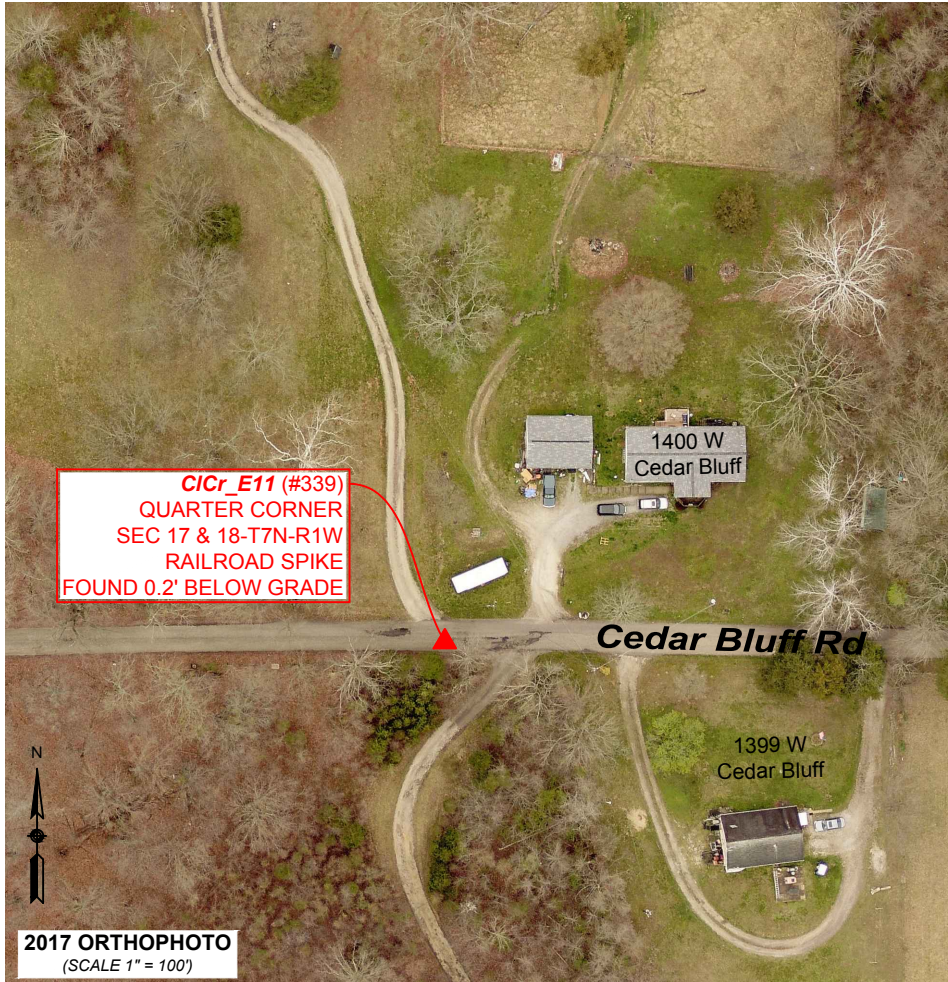

Trohn Enright-Randolph
Trohn Enright-Randolph
Monroe County Surveyor



Accepted by the Monroe
County Surveyor Review Board
on December 19, 2017



Rachel Oser
Rachel Savich Oser, State of Indiana
Professional Surveyor No. 21100022

SHEET 2 OF 2	MONUMENT RECORD CORNER ID: CICr_E11	Quarter Corner Section 17 & 18- T07N-R01W Clear Creek Township Monroe County, Indiana	 MONROE COUNTY SURVEYOR'S OFFICE Trohn Enright-Randolph Monroe County Surveyor Rachel Savich Oser Professional Surveyor 119 West 7th Street, Bloomington, IN 47404 (812) 349-2570
-----------------------	---	---	---

MONUMENT RECORD


Corner I.D. #

E-11

STATE OF INDIANA - COUNTY OF MONROE

Section Eighteen (18), Township 7 North, Range 1 West

Monument Description & Remarks: Found Railroad Spike at East 1/2 mile of
section. Corner described in Lee Utt survey dated 4/28/89; recorded
6/29/89, Book 1, Page 109. RR spike is 3.7' south of road centerline.

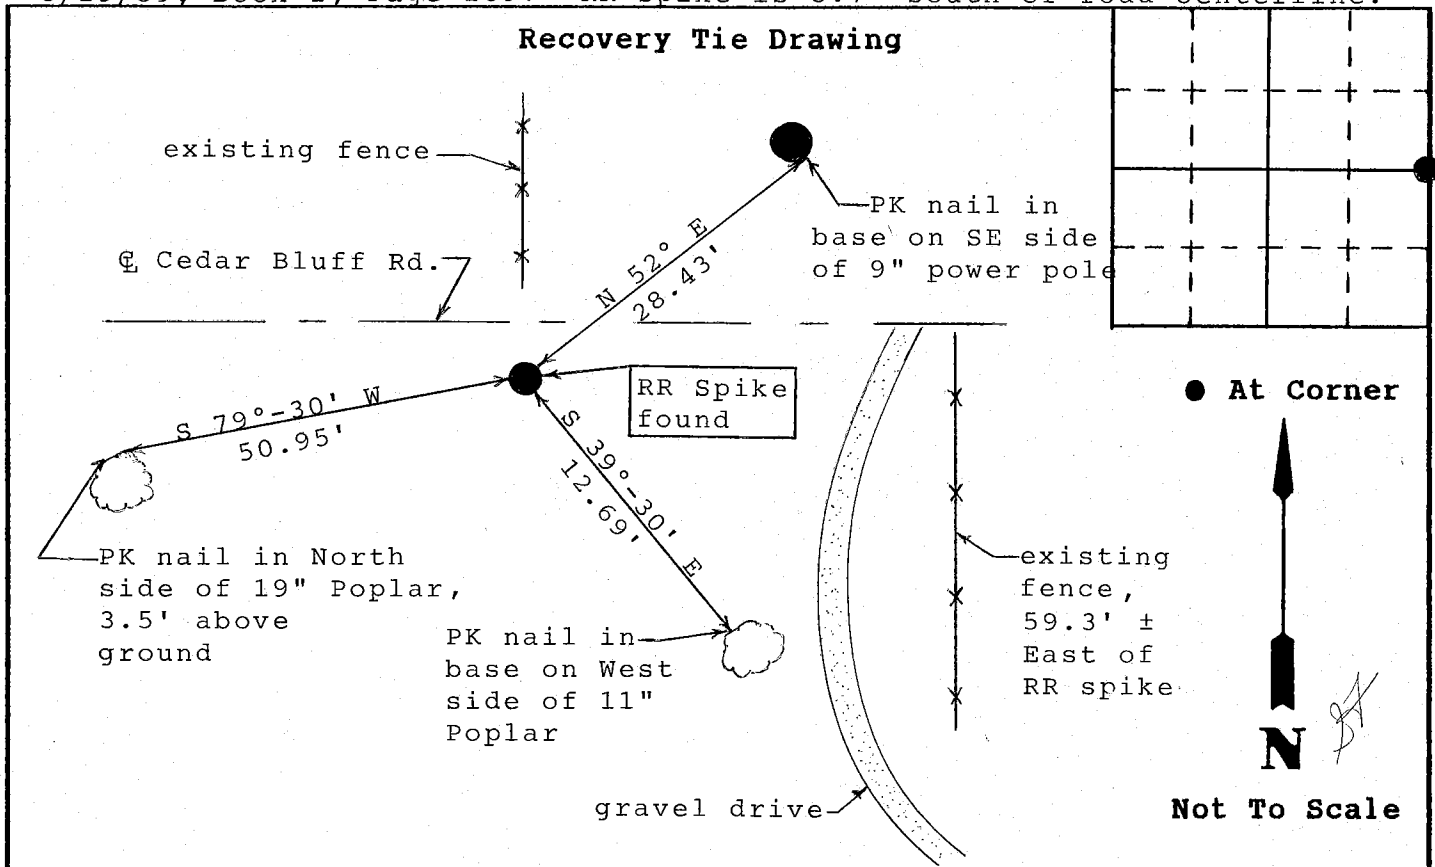

State of Indiana
County of Monroe

Space
Reserved For
Recording
Officer

I, Michael W. Friley, County Surveyor, hereby certify
that this document was prepared under my direction in
accordance with the provisions of Section 17-3-64-4
through 17-3-64-8 of the Indiana Code, being Acts of 1965,
Chapter 319; and the above data is given under my hand and
seal this 4th day of January, 19 95 A.D.

Indiana Registered Land Surveyor No. _____ or

Field Book:

Monroe County Surveyor's Office
United States Government Agency

94-01

Page:

Monroe County Surveyor
Title

36